

MULTI-FUNCTION SCALES

- 7-inch resistive touch color screen
- Upper and lower limit alarms: quantity, percentage, weight
- Zero-setting, weighing, subtracting tare value
- Counting, accumulation, percentage display
- Peak (max.) and tracking mode
- Subtractive weighing, totalization
- Overload alarm
- Data output
- Unit: kg, g, lb, oz, t



TOUCH
SCREEN

DATA
OUTPUT

8005-30




alarm light (optional)




scanner (optional)



printer (optional)

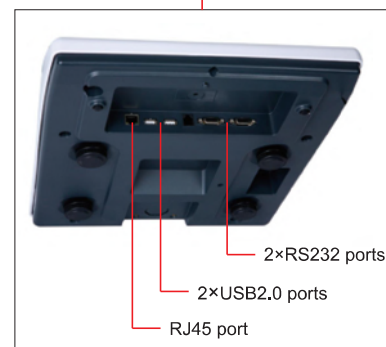

data output

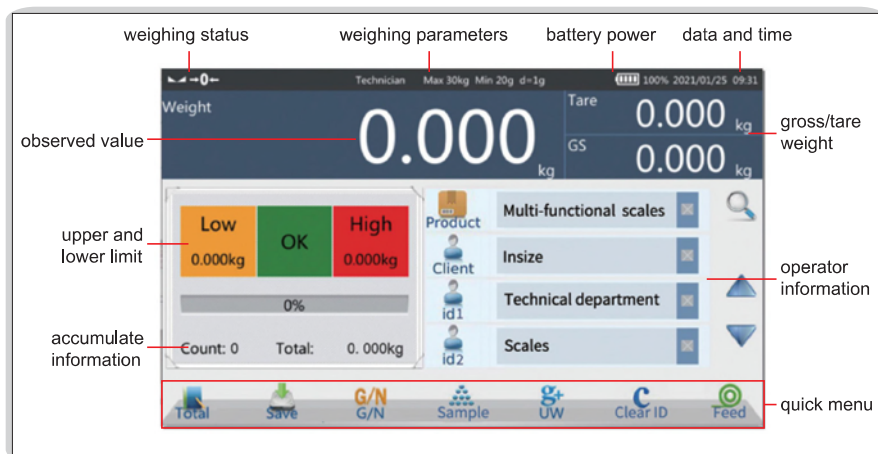

weighing test interface

NO.	Product	Weight(kg)	Unit	Quantity	Time
1	Sample a	0.3	kg	0	18:50
2	Sample b	0.22	kg	0	18:57
3	Sample c	0.58	kg	0	19:06
4	Sample d	0.21	kg	0	19:36
5	Sample e	0.57	kg	0	19:43
6	Sample f	0.34	kg	0	19:46
7	Sample g	0.21	kg	0	19:46
8	Sample h	0.21	kg	0	19:50
9	Sample i	0.57	kg	0	19:50
10	Sample j	0.93	kg	0	06:43
11	Sample k	7.6	oz	0	18:32
12	Sample l	11.8	oz	0	18:43
13	Sample m	31	oz	0	18:44

Item count: 53 Weight: 5.435kg Qty: 750pcs


records search

SPECIFICATION

Code	8005-3	8005-6	8005-15	8005-30
Maximum weighing	3kg	6kg	15kg	30kg
Minimum weighing	2g	4g	10g	20g
Resolution (d)	0.1g	0.2g	0.5g	1g
Accuracy (m is load)	m≤500g: ±0.5g 500g<m≤2kg: ±1g m>2kg: ±1.5g	m≤1kg: ±1g 1kg<m≤4kg: ±2g m>4kg: ±3g	m≤2.5kg: ±2.5g 2.5kg<m≤10kg: ±5g m>10kg: ±7.5g	m≤5kg: ±5g 5kg<m≤20kg: ±10g m>20kg: ±15g
Operation temperature	0~40°C			
Operation humidity	≤80%RH			
Power supply	rechargeable lead acid battery (6V/4Ah)			
Weighing pan size	230×300mm			

OPTIONAL ACCESSORY

Printer	8001-PRINTER
Scanner	7328-SCAN
Alarm light	8001-ALARM

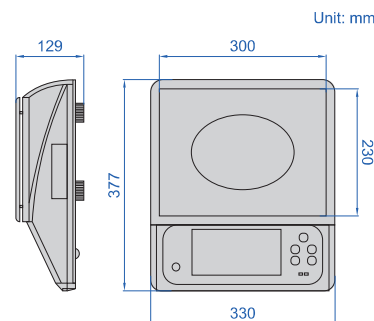

Unit: mm